## SL SHOP (Sales & Service) Ltd

## **Vehicle Health Check**

**CUSTOMER DETAIL** 

VEHICLE DETAIL

Registration

VHC NO 7646

**MOT Due** 

Mr Iain Wilson

Tel

07590 228 873

Make Mercedes-Benz

Date 2022-06-22

Н 01360 770 690

230 SL Model

Service Advisor Russell Owens

W

Chassis No 11304222009279

DSR760C

10/03/2023 Inspected By **Russell Owens** 

Mileage 12656

	Net	VAT	Total	
Initial Road Test 00IR	T .			
R Engine performance / smoke / noises	car attempts to cut out under acceleration. Advise full engine set up			
A Brake performance / spongy / pulling left or right	when holding down the brake pedal it brings the engine rpm's up indicates air leak.			
A Steering in straight position / feel / noises	steering wheel out to the left			
G Check operation of warning lights 54585				
A Check operation of wipers and washers 86000	Windscreen wash wipes both inop			
G Check operation of horn 54105				
G Check operation of parking brake 42120				
lights 82000			•	ı
G Check operation of front external lights 82195				
A Check operation of rear external lights 82225	Reverse light inop			
Interior 91000		1	1	1
G Check seat and seat belt operation 91090				
A Check interior lights 82165	Interior light inop			
G Heater motor operation 83135	Heater motor works but catches every so often.			
G Radio and aerial operation 82345				
Engine Bay 18000				
G Antifreeze strength 50000	Coolant is ok up to temperatures of minus 14 degrees. Coolant level low has been topped up			
Remove heater box lid- check bulkhead 62015	No drain holes in bulhead suspect had previous repairs and drain holes have been covered over.			
G Check battery condition 54080				
G Check charging Volts 15030				
G Check G/Box oil level 18000				
G Check engine oil level / condition 18000				
G Check for fuel leaks 07075				
Check brake fluid level / condition 42000	Brake fluid level low and is very dark in colour. Advise replace and bleed of the system.			
Under Vehicle 00UV				
A Check drop links 32060	all anti roll bar bushes are starting to perish but are not split or damaged at the moment			
Check front wishbones 33030	All 4 lower arm sealing rings are split.			
G Check shock absorbers 32000				
Check engine mountings 22010	both engine mounts are perished, near side has collapsed.			
G Check subframe bushes 33010				
Check for general oil leaks 18000	Suspected oil leaks from front crank seal. Oil leaking from steering pump. Oil also weeping past oil filter housing washer and sump plug washer.			

## SL SHOP (Sales & Service) Ltd

## **Vehicle Health Check**

CUSTOMER DETAIL VEHICLE DETAIL VHC NO 7646 Make Mr Iain Wilson Mercedes-Benz Date 2022-06-22 230 SL 01360 770 690 Model Н Service Advisor Russell Owens DSR760C Tel 07590 228 873 Registration **MOT Due** 10/03/2023 M W Chassis No 11304222009279 Inspected By **Russell Owens** 12656 Mileage

		Comments / Recommendations	Net	VAT	Total
	eck propshaft couplings ndition 41015	Rear propshaft locking tabs missing or broken, centre propshaft locking tabs are missing.			
	eck fuel pump pipes/filter ckage 47045	the main metal fuel pipe union from thd fuel pump has a lot of surface rust.			
	eck exhaust system ndition 14060	One exhaust rubber is broken. Will require replacing.			
	neral underbody rrosion / Waxoyl 61000	The car is full of very poor previous repairs. With some of them being very dangerous.			
	sual check on brake pads d discs 42000				
	eck rear drive afts/boots 35030				
Soft	Top Check 77000				
ope	eck soft top en/closure/catch echanism 7700	soft top is tight to lock down			
Wate	er Test 00WT				
R Che	eck bulkhead for leaks	Water is coming into the cabin cant see where exactly as it seems to be coming though above the offside air vent			
G Che	eck window/door seals for ks				
G Che	eck boot/rear lights for ks				
		Total	0.00	0.00	0.00

Tyres	Tread (mm)	Manufacturer	Size	Comments/Recommendations
G N/S Front				
G N/S Rear				
G O/S Front				
G O/S Rear				
G Spare				
Brakes	Drums F	Pads Dis	cs	Comments/Recommendations
		% Remaining % I	Remaining	
N/S Front	N			
N/S Rear	N			
O/S Front				
-,	N			

Photos	
Customer Signature	The work outlined in this report has been brought to my attention

This report and any costs shown are the result of a visual inspection only. Further checks may be necessary to determine the full extent of any requirements. Estimate valid for 30 days from inspection.