

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

VEHICLE DETAIL

VHC NO

8688

Make Mercedes Benz

Date

2022-11-05

Model 380SL

Service Advisor

Registration A217YMH

MOT Due

Chassis No WDB1070451A002206

Inspected By

Russell Owens

Mileage 71919

H
Tel M
W

Comments / Recommendations		Net	VAT	Total
Initial Road Test 00IRT				
G	Engine performance / smoke / noises			
A	Brake performance / spongy / pulling left or right	During braking applications on road test noticed vehicle had a tendency to pull to the right. Further investigation is recommended		
R	Steering in straight position / feel / noises	ABS warning lamp is permanently on, further investigation is recommend		
R	Check operation of warning lights 54585	ABS warning lamp is permanently on, further investigation is recommend		
A	Check operation of wipers and washers 86000	Passenger side wiper blade is split and requires replacing.		
G	Check operation of horn 54105			
G	Check operation of parking brake 42120			
lights 82000				
G	Check operation of front external lights 82195			
G	Check operation of rear external lights 82225			
Interior 91000				
R	Check seat and seat belt operation 91090	Driver's seat belt is excessively twisted and appears to be jamming. Further investigation is required.		
G	Check interior lights 82165			
G	Heater motor operation 83135			
A	Radio and aerial operation 82345	Radio and aerial power up. Unfortunately no sound is coming from speakers. Further investigation required.		
Engine Bay 18000				
G	Antifreeze strength 50000	Antifreeze strength is at -23		
G	Remove heater box lid-check bulkhead 62015			
G	Check battery condition 54080			
G	Check charging Volts 15030	When engine running voltage at battery is 13.7 volts. This indicates that the alternator is charging the battery		
A	Check G/Box oil level 18000	Test oil level with transmission temperature low,found oil level in transmission is overfilled. Suggest reducing oil level in transmission. •Dipstick tube appears loose and no securing braket at top		
A	Check engine oil level / condition 18000	Oil level ok though oil is looking dark. Recommend checking service history and replacing engine oil and filter as necessary. • Rubber securing ring missing on dipstick tube.		
G	Check for fuel leaks 07075			
R	Check brake fluid level / condition 42000	Current brake fluid boiling point is 145c The minimum recommend for DOT4 brake fluid is 155c Brake fluid change is required.		
Under Vehicle 00UV				
G	Check drop links 32060			
G	Check front wishbones 33030			
G	Check shock absorbers 32000			
G	Check engine mountings 22010			
R	Check subframe bushes 33010	Subframe bushes have collapsed and require replacing		

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

H
Tel M
W

VEHICLE DETAIL

Make **Mercedes Benz**
Model **380SL**
Registration **A217YMH**
Chassis No **WDB1070451A002206**
Mileage **71919**

VHC NO **8688**

Date **2022-11-05**
Service Advisor
MOT Due
Inspected By **Russell Owens**

Comments / Recommendations		Net	VAT	Total
A	Check for general oil leaks 18000 Historical evidence of oil leaking from engine, recommend further investigation to determine cause.			
G	Check propshaft couplings condition 41015			
G	Check fuel pump pipes/filter package 47045			
A	Check exhaust system condition 14060 Rear exhaust rubber missing, others are splitting, recommend fitting new rings.			
A	General underbody corrosion / Waxoyl 61000 Recommend cleaning down surfaces and applying a new coat of waxoyl.			
A	Visual check on brake pads and discs 42000 Rear pads approx 45% remaining Discs approx 70% remaining			
G	Check rear drive shafts/boots 35030			
Soft Top Check 77000				
G	Check soft top open/closure/catch mechanism 7700			
Water Test 00WT				
G	Check bulkhead for leaks			
G	Check window/door seals for leaks			
G	Check boot/rear lights for leaks			
Total		0.00	0.00	0.00

Tyres	Tread (mm)	Manufacturer	Size	Comments/Recommendations
G N/S Front				
G N/S Rear				
G O/S Front				
G O/S Rear				
G Spare				

Brakes	Drums	Pads	Discs	Comments/Recommendations
	% Remaining		% Remaining	
N/S Front	N			
N/S Rear	N			
O/S Front	N			
O/S Rear	N			

Photos

Customer Signature _____ The work outlined in this report has been brought to my attention

This report and any costs shown are the result of a visual inspection only. Further checks may be necessary to determine the full extent of any requirements. Estimate valid for 30 days from inspection.