

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

Mr Paul Delamain
H
Tel M 07855 415 359
W

VEHICLE DETAIL

Make Mercedes-Benz
Model SL Class
Registration E818FRO
Chassis No WDB1070412A074717
Mileage 125300

VHC NO

7442

Date 2022-05-26
Service Advisor Russell Owens
MOT Due 25/11/2022
Inspected By Matt Harvey

Comments / Recommendations		Net	VAT	Total
Initial Road Test 00IRT				
A	Engine performance / smoke / noises	There seems to be slight ticking sound when engine starts up		
A	Brake performance / spongy / pulling left or right	When car is braking the vehicle does judder slightly. ABS warning light is always on		
A	Steering in straight position / feel / noises	The Steering wheel seem to be off slightly when going straight		
A	Check operation of warning lights 54585	Washer bottle light, brake light and coolant does not work when turning on the ignition		
A	Check operation of wipers and washers 86000	Jets work but might need a slight adjustment as N/S is a bit weak		
G	Check operation of horn 54105			
G	Check operation of parking brake 42120			
lights 82000				
R	Check operation of front external lights 82195	No N/S side light as not working		
G	Check operation of rear external lights 82225			
Interior 91000				
G	Check seat and seat belt operation 91090			
R	Check interior lights 82165	Interior lights dotn work		
G	Heater motor operation 83135			
G	Radio and aerial operation 82345			
Engine Bay 18000				
R	Antifreeze strength 50000	Anti freeze level is really low but the strength is OK and able to reach -23		
A	Remove heater box lid-check bulkhead 62015	Surface corrosion on the bulkhead		
G	Check battery condition 54080			
G	Check charging Volts 15030	12.5		
G	Check G/Box oil level 18000			
G	Check engine oil level / condition 18000			
G	Check for fuel leaks 07075			
G	Check brake fluid level / condition 42000	Dot 3/4 at 320 degrees c		
Under Vehicle 00UV				
A	Check drop links 32060	Slight play on the O/S drop link on the rear		
G	Check front wishbones 33030			
G	Check shock absorbers 32000			
G	Check engine mountings 22010			
G	Check subframe bushes 33010			
A	Check for general oil leaks 18000	Seems to be an old leak from the gear box and gear box sump pan need further investigation to confirm. Same with the sump slight leak but need further investigation		

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

Mr Paul Delamain
H
Tel M 07855 415 359
W

VEHICLE DETAIL

Make Mercedes-Benz
Model SL Class
Registration E818FRO
Chassis No WDB1070412A074717
Mileage 125300

VHC NO

7442

Date 2022-05-26
Service Advisor Russell Owens
MOT Due 25/11/2022
Inspected By Matt Harvey

Comments / Recommendations		Net	VAT	Total
G	Check propshaft couplings condition 41015			
A	Check fuel pump pipes/filter package 47045	Fuels pipes staring to look worn may need replacing In the future		
G	Check exhaust system condition 14060			
A	General underbody corrosion / Waxoyl 61000	No wax oil the is corrossion in areas of the underbody on the sills on both sides of the car		
G	Visual check on brake pads and discs 42000	Brakes are a good thickness O/S rear has worn down more the near side rear to 6mm		
G	Check rear drive shafts/boots 35030			
Soft Top Check 77000				
G	Check soft top open/closure/catch mechanism 7700			
Water Test 00WT				
G	Check bulkhead for leaks			
G	Check window/door seals for leaks			
G	Check boot/rear lights for leaks			
Total		0.00	0.00	0.00

Tyres	Tread (mm)	Manufacturer	Size	Comments/Recommendations
G N/S Front	6.0			
G N/S Rear	7.0			
G O/S Front	6.0			
G O/S Rear	7.0			
G Spare	3.5			

Brakes	Drums	Pads	Discs	Comments/Recommendations
		% Remaining	% Remaining	
N/S Front	N	R 8	R 8	
N/S Rear	N	R 8	R 10	
O/S Front	N	R 8	R 8	
O/S Rear	N	R 6	R 10	

Photos

Remove heater box lid-check bulkhead



Remove heater box lid-check bulkhead




Check for general oil leaks 18000 -



Check for general oil leaks 18000 -
Image 2 of 2



General underbody corrosion / Waxoyl
61000 - Image 1 of 4

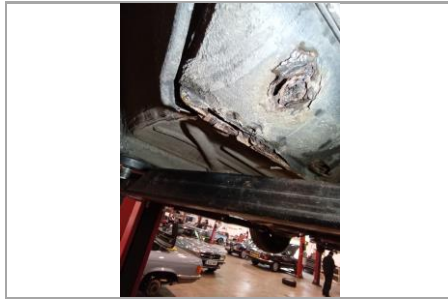

General underbody corrosion / Waxoyl
61000 - Image 2 of 4



General underbody corrosion / Waxoyl
61000 - Image 3 of 4



General underbody corrosion / Waxoyl
61000 - Image 4 of 4



Customer Signature _____ The work outlined in this report has been brought to my attention

This report and any costs shown are the result of a visual inspection only. Further checks may be necessary to determine the full extent of any requirements. Estimate valid for 30 days from inspection.