

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

Mrs Mary Henderson
 H 01383 821 997
 Tel M
 W

VEHICLE DETAIL

Make Mercedes-Benz
 Model SL Class
 Registration R751PSH
 Chassis No WDB1290632F166864
 Mileage

VHC NO

9946

Date 2023-05-19

Service Advisor

MOT Due 21/11/2023

Inspected By m - Stefan Rich

| Comments / Recommendations | | Net | VAT | Total |
|--------------------------------|--|---|-----|-------|
| Initial Road Test 00IRT | | | | |
| G | Engine performance / smoke / noises | | | |
| G | Brake performance / spongy / pulling left or right | | | |
| A | Steering in straight position / feel / noises | Steering slightly out to the left | | |
| G | Check operation of warning lights 54585 | | | |
| G | Check operation of wipers and washers 86000 | | | |
| G | Check operation of horn 54105 | | | |
| G | Check operation of parking brake 42120 | | | |
| lights 82000 | | | | |
| G | Check operation of front external lights 82195 | Headlight washers Don't work | | |
| A | Check operation of rear external lights 82225 | Slightly blueish reverse lights | | |
| Interior 91000 | | | | |
| G | Check seat and seat belt operation 91090 | | | |
| G | Check interior lights 82165 | | | |
| G | Heater motor operation 83135 | | | |
| G | Radio and aerial operation 82345 | | | |
| Engine Bay 18000 | | | | |
| G | Antifreeze strength 50000 | | | |
| N/A | Remove heater box lid-check bulkhead 62015 | Na | | |
| G | Check battery condition 54080 | | | |
| G | Check charging Volts 15030 | 14.3v | | |
| G | Check G/Box oil level 18000 | | | |
| G | Check engine oil level / condition 18000 | | | |
| G | Check for fuel leaks 07075 | | | |
| G | Check brake fluid level / condition 42000 | | | |
| Under Vehicle 00UV | | | | |
| G | Check drop links 32060 | | | |
| A | Check front wishbones 33030 | Heavily corroded | | |
| G | Check shock absorbers 32000 | | | |
| G | Check engine mountings 22010 | | | |
| N/A | Check subframe bushes 33010 | NA | | |
| A | Check for general oil leaks 18000 | Leaking around front timing seal and oil present around intake manifold | | |
| G | Check propshaft couplings condition 41015 | | | |

SL SHOP (Sales & Service) Ltd

Vehicle Health Check

CUSTOMER DETAIL

Mrs Mary Henderson
 H 01383 821 997
 Tel M
 W

VEHICLE DETAIL

Make Mercedes-Benz
 Model SL Class
 Registration R751PSH
 Chassis No WDB1290632F166864
 Mileage

VHC NO

9946

Date 2023-05-19

Service Advisor

MOT Due 21/11/2023

Inspected By m - Stefan Rich


| Comments / Recommendations | | Net | VAT | Total |
|-----------------------------|--|---|------|-------|
| G | Check fuel pump pipes/filter package 47045 | | | |
| G | Check exhaust system condition 14060 | | | |
| A | General underbody corrosion / Waxoyl 61000 | Heavily corroded everywhere just covered on the floor pans with black wax | | |
| A | Visual check on brake pads and discs 42000 | Rear discs are heavily scored | | |
| G | Check rear drive shafts/boots 35030 | | | |
| A | Wheel bearings | Osf wheel bearing needs adjusting | | |
| Soft Top Check 77000 | | | | |
| G | Check soft top open/closure/catch mechanism 7700 | | | |
| Water Test 00WT | | | | |
| G | Check bulkhead for leaks | | | |
| G | Check window/door seals for leaks | | | |
| G | Check boot/rear lights for leaks | | | |
| Total: | | 0.00 | 0.00 | 0.00 |

| Tyres | Tread (mm) | Manufacturer | Size | Comments/Recommendations |
|-------------|------------|--------------|------|--------------------------|
| G N/S Front | 6.0 | | | |
| G N/S Rear | 7.0 | | | |
| G O/S Front | 6.5 | | | |
| G O/S Rear | 7.0 | | | |
| G Spare | 6.0 | | | |


| Brakes | Drums | Pads | Discs | Comments/Recommendations |
|-----------|-------|-------------|-------------|--------------------------|
| | | % Remaining | % Remaining | |
| N/S Front | N | G 50 | G 45 | |
| N/S Rear | N | A 30 | G 45 | |
| O/S Front | N | G 50 | G 45 | |
| O/S Rear | N | A 30 | G 45 | |

Photos


Check front wishbones 33030 - Image 1

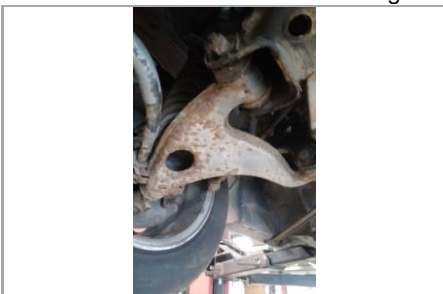


Check front wishbones 33030 - Image 2

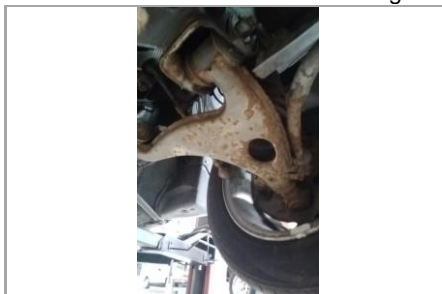

Check for general oil leaks 18000 -

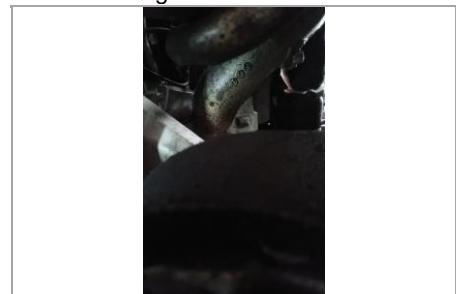

Check for general oil leaks 18000 -
Image 2 of 3

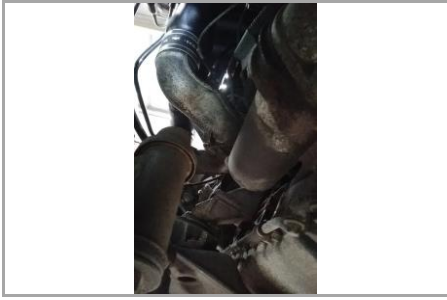

Check for general oil leaks 18000 -
Image 3 of 3



General underbody corrosion / Waxoyl
61000 - Image 1 of 7



General underbody corrosion / Waxoyl
61000 - Image 2 of 7



General underbody corrosion / Waxoyl
61000 - Image 3 of 7



General underbody corrosion / Waxoyl
61000 - Image 4 of 7



General underbody corrosion / Waxoyl
61000 - Image 5 of 7




General underbody corrosion / Waxoyl
61000 - Image 6 of 7



General underbody corrosion / Waxoyl
61000 - Image 7 of 7



Visual check on brake pads and discs
42000 - Image 1 of 2

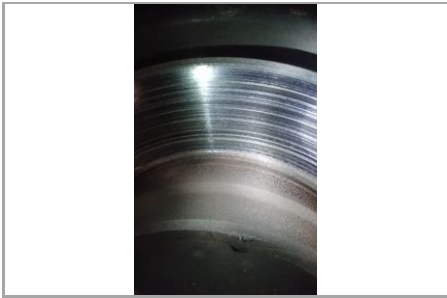

Visual check on brake pads and discs
42000 - Image 2 of 2



Customer Signature _____

The work outlined in this report has been brought to my attention

This report and any costs shown are the result of a visual inspection only. Further checks may be necessary to determine the full extent of any requirements. Estimate valid for 30 days from inspection.